

N432UT parts required to make flyable.

Description	Part Number	Quantity Needed	Cost	Total Cost	Lead Time	Notes
Tail Rotor Balde	222-016-001-139	1	\$ 3,000.00	\$ 3,000.00	14 Days	Feather bearing replacement.
Engine Control Unit (ECU)	23064657	1	\$ 29,262.00	\$ 29,262.00		Exchange Cost
Aircraft Battery	31908-001	1				We have a spare. Will be checking serviceability.
Main Driveshaft	222-044-006-108	2	\$ 33,525.00	\$ 67,050.00	Unknown	This cost is for 2 inner couplings 222-044-607-103, and 2 outer couplings. These coupling are notorioious for wearing out. This is a guess on my part, a middle ground figure. Bell has no stock on either part number. Next available units according to Vista is June 30, 2010 for the inner couplings and November 30, 2010 for the outer couplings.
Tail Rotor Driveshaft Coupling	222-044-618-101	1	\$ 21,730.00	\$ 21,730.00	In Stock at BHT	This is a worst case figure for an inner and outer coupling. I am expecting the coupling that we have to be serviceable and just need repacking.
Engine Oil Tank	222-065-505-161	1	\$ 29,092.00	\$ 29,092.00	Unknown	We have a tank with a suspect leak (most likely repairable). It will be checked prior to locating a replacement. Bell has no stock on this item. Next available date from BHT May 24, 2011.
Turbine	23063354	1	\$ 86,000.00	\$ 86,000.00	75 Days	Average Premier turbine overhaul cost
Burner Can	23030911	1	\$ 3,600.00	\$ 3,600.00		Exchange Cost. May be repairable.
Tail Rotor Servo	222-382-002-105	1	\$ 31,815.00	\$ 31,815.00		Exchange Cost
Hydromechanical Unit (HMU)	23078035	1	\$ 30,582.50	\$ 30,582.50		Exchange Cost
Radar altimeter/Vertical Speed Indicator KAV-485	066-3077-38	1	\$ 3,500.00	\$ 3,500.00		KAV-485. Internet search found a serviceable unit for this amount.
EFIS Tube	430-375-002-109	1				Gerry Indicates this should be 100% warranty
Tail rotor slider assembly	222-012-716-005	1	\$ 5,915.00	\$ 5,915.00	In stock at BHT	New cost from BHT
Oil Cooler Blower	230-365-001-103	2	\$ 14,235.00	\$ 28,470.00	In stock at BHT	Repair cost is 12,152.00 and a 2.5 month lead time. Bell has 9 in stock at this cost.
Fluid Filled Isolator	430-310-200-107	1	\$ 45,758.00	\$ 45,758.00	In stock at BHT	No exchange units available. Bell has 11 in stock
VHF Comm Control Head KFS 598A	066-1282-80	1	\$ 2,700.00	\$ 2,700.00		Exchange Cost